

Operated by Nuclear Management Company, LLC

October 13, 2004

10 CFR 50.73(a)(2)(iv)(A)

U. S. Nuclear Regulatory Commission ATTN: Document Control Desk Washington, DC 20555-0001

Palisades Nuclear Plant Docket 50-255 License No. DPR-20

<u>Licensee Event Report 04-001, Reactor Protection System and Auxiliary Feedwater System Actuation</u>

Licensee Event Report (LER) 04-001 is attached. The LER describes a manual actuation of the reactor protection system and subsequent actuation of the auxiliary feedwater system. This event is reportable in accordance with 10 CFR 50.73(a)(2)(iv)(A).

Summary of Commitments

This letter contains no new commitments and no revisions to existing commitments.

Daniel J. Malone

Site Vice President, Palisades Nuclear Plant

Nuclear Management Company, LLC

Enclosure (1)

CC Administrator, Region III, USNRC
Project Manager, Palisades, USNRC
Resident Inspector, Palisades, USNRC

TEZZ

ENCLOSURE 1

LER 04-001, REACTOR PROTECTION SYSTEM AND AUXILIARY FEEDWATER SYSTEM ACTUATION

NRC FORM 366 U.S. NUCLEAR REGULATORY COMMISSION (6-2004)					APPROVED BY OMB NO. 3150-0104						EXPIR	ES 6-30-2007				
LICENSEE EVENT REPORT (LER) (See reverse for required number of digits/characters for each block)							Estimated burden per response to comply with this mandatory collection request: 50 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records and FOIA/Privacy Service Branch (T-5 F52), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet email to infocollects@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202, (3150-0066), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.									
FACILITY NAME (1)								DOCKET NUMBER (2)						PAGE (3)		
Palisades Nuclear Plant								05000-255					1 of 2			
TITLE (4)						-					·					
Reactor F	Protection	Syste	m and	Auxiliary Fe	edwa	ater S	Sys	ten	n Actua	tio	n					
EV	NT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)						
МО	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REV NO	мо	DA	ιΥ	YEAR	FACILITY NAME			DOCKET NUMBER			
08	31	2004	2004	001	00	10	1:	3	2004	FACILITY NAME DOCKET NUMBER						
OPER/	TING	1		THIS REPORT I	S SUBI	VITTED	PUR	RSUA	ANT TO TH	E RI	EQUIREMENTS	S OF 10 CFR	: (Check all that ap	ply) (11)	
MODE (9)		1	20	20.2201(b)			20.2203(a)(3)(ii)			50.73(a)(2)(ii)(B)		ii)(B)	50.73(a)(2)(ix)(A)			
POWER LEVEL (10)		95%					20.2203(a)(4)			50.73(a)(2)(iii)		iii)	50.73(a)(2)(x)			
							36(c)(1)(i)(A)			X 50.73(a)(2)(iv)(A)		iv)(A)	73.71(a)(4)			
			20.2203(a)(2)(i)			50.36(c)(1)(ii)(A)			_	50.73(a)(2)(73.71(a)(5)			
				.2203(a)(2)(ii)			50.36(c)(2)				50.73(a)(2)(OTHER			
				20.2203(a)(2)(iii)		50.46(a)(3)(ii)			_	50.73(a)(2)(Specify in Abstract below or in NRC Form 366A			
				20.2203(a)(2)(iv)			50.73(a)(2)(i)(A)			_	50.73(a)(2)(v)(D)		THE TOTAL COURT			
				20.2203(a)(2)(v)			50.73(a)(2)(i)(B)					50.73(a)(2)(vii)				
				20.2203(a)(2)(vi)			50.73(a)(2)(i)(C) 50.73(a)(2)(ii)(A)			_	50.73(a)(2)(viii)(A)					
	real figure		20	.2203(a)(3)(i)							50.73(a)(2)(viii)(B)	31			
NAME				LICE	NSEE	CONI	ACI	FO	R THIS L	-	<u> </u>	IDED (Include	1- 1-	Code\		
NAME										16	LEPHONE NUI	•		•		
Barb Dots	on	COMB	I STE ON	IE LINE FOR EA	CHC	OVEO	JEN	TE	AII LIDE D	EC	CDIDED IN T		•	54-2265		
				MANU-	REPO	RTABLE	SLE (MANU-	REPORTABLE	
CAUSE	SYSTEM	4 COI	MPONENT_	FACTURER	<u> </u>	EPIX_	- :	—	CAUSE	+	SYSTEM COMPO		NENT	FA CTURER	TO EPIX	
ח			MO	I A180		N	1:1					l				

ABSTRACT

On August 31, 2004, at 0715 hours, the plant was operating at approximately 100% power. A rapid plant down power was commenced following report of a fire in the vicinity of the P-2B condensate pump lower motor bearing. At 0718 hours, the reactor was manually tripped from approximately 95% power, in conjunction with securing the P-2B condensate pump, and the imminent loss of main feedwater. Following the reactor trip, the auxiliary feedwater system started automatically to maintain steam generator water level. The plant was stabilized in Mode 3. Overheating, and ultimately fire, at the condensate pump lower motor bearing were caused by pump and motor misalignment following maintenance in July 2004. The pump and motor misalignment occurred as a result of inadequate maintenance instructions. Proper alignment criteria were established and incorporated into the work instruction when the repaired motor was reinstalled in September 2004.

X NO

SUPPLEMENTAL REPORT EXPECTED (14)

YES (If yes, complete EXPECTED SUBMISSION DATE).

EXPECTED

SUBMISSION

DATE (15)

MONTH

DAY

YEAR

The safety significance of this event was minimal. All safety systems functioned as expected during the plant trip.

This event is reportable in accordance with 10 CFR 50.73(a)(2)(iv)(A) as an event that resulted in a manual actuation of the reactor protection system and automatic actuation of the auxiliary feedwater system.

LICENSEE EVENT REPORT (LER)

TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)		PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	2 of 2
Palisades	05000-255	2004	001	00	

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

EVENT DESCRIPTION

On August 31, 2004, at 0715 hours, the plant was operating at approximately 100% power. A rapid plant down power was commenced following report of a fire in the vicinity of the P-2B condensate pump [P;SD] lower motor [MO] bearing. At 0718 hours, the reactor was manually tripped from approximately 95% power, in conjunction with securing P-2B condensate pump, and the imminent loss of main feedwater [SJ]. Following the reactor trip, the auxiliary feedwater system [BA] started automatically to maintain steam generator [SG] water level. The plant was stabilized in Mode 3.

This event is reportable in accordance with 10 CFR 50.73(a)(2)(iv)(A) as an event that resulted in a manual actuation of the reactor protection system [JC] and automatic actuation of the auxiliary feedwater system.

CAUSE OF THE EVENT

Overheating, and ultimately fire, at the condensate pump lower motor bearing were caused by pump and motor misalignment following maintenance in July 2004. The pump and motor misalignment occurred as a result of inadequate maintenance instructions.

SAFETY SIGNIFICANCE

The safety significance of this event was minimal. All safety systems functioned as expected during the plant trip.

CORRECTIVE ACTIONS

Proper alignment criteria were established and incorporated into the work instruction when the repaired motor was reinstalled in September 2004.

PREVIOUS SIMILAR EVENTS

None.